

2DM2260 Digital Stepper Drive

Manual



Shenzhen Just Motion Control Electro-mechanics Co., Ltd

 $\mathtt{TEL:} + 86 \text{-} 0755 \text{-} 26509689$

FAX:+86-0755-26509289

www.jmc-motion.com

Email:info@jmc-motion.com

Address: Floor2, Building A, Hongwei Industrial Zone No.6,

Liuxian 3rd Road, Shenzhen. China

Thanks for selecting JMC stepper motor driver. We hope that the superior performance, outstanding quality, excellent cost performance of our product can help you accomplish your motion control project.

The content in this manual has been carefully prepared and is believed to be accurate, but noresponsibility is assumed for inaccuracies.

All the contents of this manual, copyright is owned by the Shenzhen JUST MOTION CONTROL electromechanical Co., Ltd. Without JMC permission, no unit or individual is allowed to copy.

Shenzhen Just Motion Control Electro-mechanics Co., Ltd

Version Editor	Verifier
----------------	----------

V1 10	R R D	R&D
V 1.1U	Rad	I K&D

Contents

1. Overview	6 ·
2. Features	6 ·
3. Ports Introduction	8 -
3.1 Control Signal Input Ports	8
3.2 ALM signal output ports	8 -

3.3 Power Interface Ports	10 -
4. Technological Index	11 -
5. Connections to Control Signal	12 -
5.1 Connections to Common Anode	12 -
5.2 Connections to Common Cathode	12 -
5.3 Connections to Differential Signal	13 -
5.4 Connections to 232 Serial Communication Interface	15 -
5.5 Sequence Chart of Control Signals	15 -
6. DIP Switch Setting	17 -
6.1 Activate Edge Setting	17 -
6.2 Running Direction Setting	17 -
6.3 Micro steps Setting	17 -
7. Faults alarm and LED flicker frequency	19 -
8. Appearance and Installation Dimensions	21 -
9. Typical Connection	22 -
10. Parameter Setting	23 -
11. Processing Methods to Common Problems and Faults	28 -
11.1 Power on power light off	28 -
11.2 Power on red alarm light on	28 -
11.3 After input pulse signal but the motor not running	28 -

1. Overview

The 2DM2260 is a two phase digital stepper driver based on DSP. Its Micro step resolutions and output current are programmable. And it has advanced control algorithm, which can brings a unique level of system smoothness, provides optimum torque and mid-range instability. The control algorithm of Multi-Stepping can make stepper motor has smooth system performance. The control algorithm of torque compensation can improve the torque of motor in the high speed. The control algorithm of motor self-test and parameter auto-setup technology offers optimum responses with different motors and easy-to-use. The control algorithm of smoothness can enhance the acceleration and deceleration of motor. Its unique features make the 2DM2260 to be an ideal solution for applications.


2. Features

- Parameter auto-setup and motor self-test
- Multi-Stepping inside
- ◆ Small noise, low heating, smooth movement
- ◆ Torque compensation in high speed
- ◆ Variable current control technology, High current efficiency
- Accelerate and decelerate control inside, Great improvement in smoothness of starting or stopping the motor

- ◆ Support PUL/DIR and CW/CCW modes
- ◆ Storage the position of motor
- Optically isolated input and compatible with 5V or 24V
- ◆ User-defined micro steps
- ◆ Microstep resolutions and Output current programmable
- Over current, over voltage and low voltage protection
- ◆ Green light means running while red light means protection or off line


3. Ports Introduction

3.1 Control Signal Input Ports

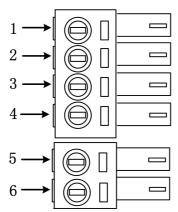


Port	Symbol	Name	Remark
1	DIR-	Direction signal-	Compatible with
2	DIR+	Direction signal+	5V or 24V
3	PLS-	Pulse signal -	Compatible with
4	PLS+	Pulse signal +	5V or 24V
5	ENA-	Enable signal -	Compatible with
6	ENA+	Enable signal +	5V or 24V

 3.2 ALM signal output ports



Port	Symbol	Name	Remark
1	ALM+	Alarm output +	
2	ALM-	Alarm output -	<u></u>

3.3 Power Interface Ports

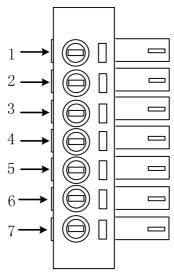


Port	Identification	Symbol	Name	Remark	
1		A+	Phase A+	Motor Phase A	
2	Motor Phase	A-	Phase A-	Wiotoi Pilase A	
3	Wire Input Ports	B+	Phase B+	M (DI D	
4		В-	Phase B-	Motor Phase B	
5	Power Input	VCC	Input Power +	AC80V-240V	
6	Ports	GND	Input Power-	- AC80V-240V	

4. Technological Index

Input V	oltage o	80~240VAC	
Output (Current	8A	
Pulse Frequ	iency max	200K	
Communic	cation rate	57.6Kbps	
		• Over current peak value 15A±10%	
Prote	ction	• Over voltage value130V	
		• The over position error range can	
		be set through the HISU	
Overall Dimen	sions (mm)	$192\times127\times85$	
Wei	ght	Approximate 1500g	
	Environment	Avoid dust, oil fog and corrosive gases	
	Operating	+70°C Max	
Environment	Temperature	+70 C Iviax	
	Storage	-20°C∼+80°C	
Specifications	Temperature	-20 C∼+80 C	
	Humidity	40~90%RH	
	Cooling	Natural cooling or forced air cooling	
	method		

5. Connections to Control Signal

5.1 Connections to Common Anode

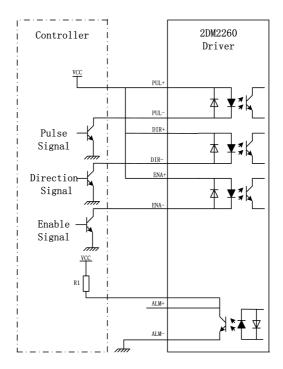


Remark:

VCC is compatible with 5V or 24V;

 $R(3\sim5K)$ must be connected to control signal terminal.

5.2 Connections to Common Cathode

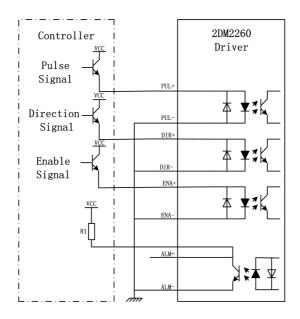


Remark:

VCC is compatible with 5V or 24V;

 $R(3\sim5K)$ must be connected to control signal terminal.

5.3 Connections to Differential Signal

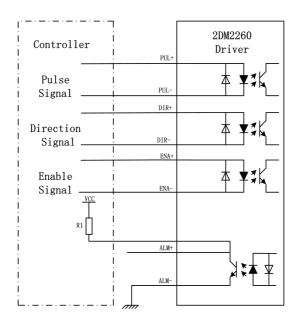


Remark:

VCC is compatible with 5V or 24V;

 $R(3\sim5K)$ must be connected to control signal terminal.


5.4 Connections to 232 Serial Communication Interface

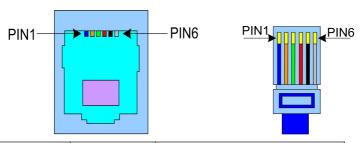

Crystal Head	Definition	Remark	
foot			
1	TXD	Transmit Data	
2	RXD	Receive Data	
4	+5V	Power Supply to HISU	
6	GND	Power Ground	

5.5 Sequence Chart of Control Signals

In order to avoid some fault operations and deviations, PUL, DIR and ENA should abide by somerules, shown as following diagram:

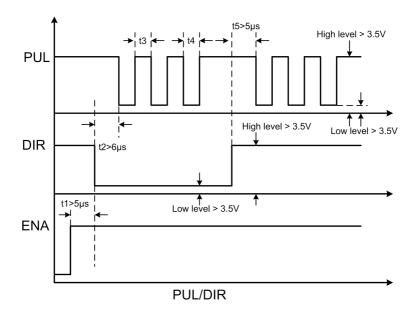

Remark:

- a. t1: ENA must be ahead of DIR by at least 5 μ s. Usually, ENA+ and ENA- are NC (notconnected).
- b. t2: DIR must be ahead of PUL active edge by 6 μ s to ensure correct direction;
- c. t3: Pulse width not less than $2.5 \mu s$;
- d. t4: Low level width not less than $2.5 \mu s$.

6. DIP Switch Setting

6.1 Current Setting

The current setting is in the following table.

Dial switch Current	D1	D2	D3
1. 3A	0	0	0
1.8A	1	0	0
2. 5A	0	1	0
3. 1A	1	1	0
3. 7A	0	0	1
4. 3A	1	0	1
5. 0A	0	1	1
5. 6A	1	1	1

6.2 Standstill current Setting

SW4 is used for setting the standstill current, "off" means the standstill current is set to be half of the selected dynamic current or other current, which can be set by the HISU, the details can be seen in the tenth sections. while "on" means the standstill current is set to be the same as the selected dynamic current.

6.3 Micro steps Setting

The micro steps setting is in the following table. And the micro steps can be also setting through the HISU. The details can be seen in the tenth sections.

Dial switch Microsteps	D5	D6	D7	D8
Default	1	1	1	1
400	0	1	1	1
500	1	0	1	1
800	0	0	1	1
1000	1	1	0	1
1250	0	1	0	1
1600	1	0	0	1
2000	0	0	0	1
2500	1	1	1	0
3200	0	1	1	0
4000	1	0	1	0
5000	0	0	1	0
6400	1	1	0	0
8000	0	1	0	0
10000	1	0	0	0

12800 0	0	0	0
---------	---	---	---


6.4 功能设置

0.4 功能以直		
DP4	ON Turn off phase detecti	
	0FF	Phase detection is on
DP3	ON	Through the pulsefrequency of 100K
	OFF	Through the pulse frequency of 200K
DP2	ON	Double pulse mode (CW/CCW)
	0FF	Single pulse mode(PUL+DIR)
DP1	ON	Self-test mode (60 r/min)
	0FF	External pulse mode

6.5 脉冲平滑设置

D0	No smooth parameters		
D1-D7	Pulse smoothing coefficient, this		
	effect is gradually increasing		

 7. Faults alarm and LED flicker frequency




Flicker	Description to the Faults
Frequency	
1	Error occurs when the motor coil current exceeds
	the drive's current limit.
2	Voltage reference error in the drive
3	Parameters upload error in the drive
4	Error occurs when the input voltage exceeds the
	drive's voltage limit.

8. Appearance and Installation Dimensions

9. Typical Connection

Here is the typical connection of 2DM2260.

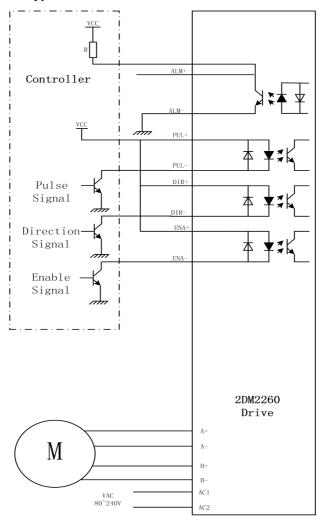

10. Parameter Setting

The parameter setting method of 2DM2260 drive is to use a HISU adjuster through the 232 serial communication ports, only in this way we canset the parameters we want. There are a set of best default parameters to the corresponding motor which are carefully adjusted by our engineers, users only need refer to the following table, specific condition and set the correct parameters.

Actual value = Set value \times the corresponding dimension

Mode	Definition	Range	Dime-	Drive	Default
			nsion	Restart	Value
P1	Current loop Kp	0-4000	1	Y	4000
P2	Current loop Ki	0—1000	1	Y	100
P3	Damping coefficient	0—500	1	N	100
P4	Amplitude of first	0—100	1	N	0
	resonance point				
P5	Phase of first	0—100	1	N	0
	resonance point				
P6	Amplitude of	0—100	1	N	0
	second resonance				
	point				
P7	Phase of second	0—100	1	N	0
	resonance point				
P8	Amplitude of	0—100	1	N	0
	third resonance point				
P9	Reserved				
P10	Enable signal level	0—1	1	N	1
P11	Reserved				

P12	Reserved				
P13	Command Type	0—1	1	N	0
P14	User-defined micro steps	4—1000	50	Y	0
P15	Time of standstill current	0—4000	1ms	Y	1000
P16	Percentage of standstill current	0—100	1	Y	50
P17	Speed smoothness	0—10	1	Y	0
P18	Enable of position memory	0—1	1	Y	0
P19	User-defined resistance of motor	0—100	mh	Y	0
P20	User-defined inductance of motor	0—100	0.10hm	Y	0
P21	Result of position memory	0—128	1		0
P22	IO input filter parameters	0—100	1s	Y	3
P23	Phase detection switch	0—1	1	Y	0
P24	Save				
P25	Save				

There are total 25 parameter configurations, use the HISU to download the configured parameters to the drive, the detail descriptions to every parameter configuration are as follows:

Item	Description		
	Increase Kp to make current rise fast. Proportional Gain determines the response of the drive to setting command. Low Proportional Gain provides a stable system (doesn't oscillate), has low stiffness, and the		
Current loop Kp	current error, causing poor performances in tracking current setting command in each step. Too large proportional gain values will cause oscillations and unstable system.		
Current loop Ki	Adjust Ki to reduce the steady error. Integral Gain helps the drive to overcome static current errors. A low or zero value for Integral Gain may have current errors at rest. Increasing the integral gain can reduce the error. If the Integral Gain is too large, the system may "hunt" (oscillate) around the desired position.		
Damping coefficient	This parameter is used to change the damping coefficient in case of the desired operating state is under resonance frequency.		
Amp1—3	2DM2280 Driver provides robust anti-resonance control to stop the vibrations and maintain		
Phase 1—3	equilibrium. Amp1 and Phase1 is Phase adjustment for 1st and		

	Amplitude adjustment for 1st resonance area			
	respectively. Usually between 0.6rps and 1.2rps.			
	Amp2 and Phase2 is Phase adjustment for 2nd and			
	Amplitude adjustment for 2nd resonance area			
	respectively. Usually between 1.2rps and 2.4rps.			
	Amp3 and Phase3 is Phase adjustment for 3rd and			
	Amplitude adjustment for 3rd resonance area			
	respectively. Usually between 2.4rps and 4.8rps.			
Enable Cantual	This parameter is set to control the Enable input			
Enable Control	signal level, 0 means low, while 1 means high.			
	This parameter is set of user-defined micro steps.			
User-defined	The actual micro steps = the set value \times 50. For			
	example, if the parameter is 4, the micro steps is 4			
micro steps	\times 50 =800. But If this parameter is 0, which means			
	micro steps is set by the outer DIP switches.			
T: 6	This parameter is set the time when the standstill			
Time of standstill current	current is set to be half of the selected dynamic			
	current or other current,			
Percentage of	This parameter is set the percentage of standstill			
standstill current	current.			
Speed	This parameter is set to control the smoothness of			
smoothness	the speed of the motor while acceleration or deceleration, the larger the value, the smoother the			

speed in acceleration or deceleration.

Enable of position memory

This parameter is set to enable the function of position memory. 0 means disable, while 1 means enable. If set 1, the 2DM2280can remember the position of motor in the next time of power on.

Command Type

This parameter is set to choice the PUL/DIR mode or CW/CCW mode. 0 means PUL/DIR mode, while means CW/CCW mode.

User-defined resistance of motor

This parameter is set the resistance of motor. 0 means 2DM2280 gets the resistance by control algorithm of Parameter auto-setup, while 1 means 2DM2280 gets the resistance through user sets.

User-defined inductance of motor

This parameter is set the inductance of motor. 0 means 2DM2280 gets the inductance by control algorithm of Parameter auto-setup, while 1 means 2DM2280 gets the inductance through user sets.

Result of position memory	This parameter is set to control the smoothness of Display the result of position memory
Time of enable	This parameter is set of the time when enable the
position memory	position memory. The time is mean the spaceoftime
	to stop plus input.

11. Processing Methods to Common Problems and

Faults

11.1 Power on power light off

No power input, please check the power supply circuit. The voltage is too low.

11.2 Power on red alarm light on

- Please check the motor is connected with the drive.
- The stepper digital drive is over voltage or under voltage. Please lower or increase the input voltage.

11.4 After input pulse signal but the motor not running

- Please check the input pulse signal wires are connected in reliable way.
- Please make sure the input pulse mode is corresponding with the real input mode.
- The Driver is disabled